Additional Resources: Product Page | <u>3D Model</u>

date 09/12/2024 page 1 of 5

### SERIES: PS01 | DESCRIPTION: PRESSURE SENSOR

#### FEATURES

- temperature compensated
- multiple pressure range options

same sky

- absolute, gauge and sealed pressure options
- stainless steel housing
- o-ring seal



## ROHS

#### **SPECIFICATIONS**

parameter	conditions/description	min	typ	max	units
pressure range	see Pressure Specifications for more details	0		6	MPa
pressure reference	gauge pressure, absolute pressure, sealed gauge press	ue			
excitation		4.5		5.5	V
output signal	ratiometric	0.5		4.5	V
insulation resistance	at 250 Vdc	200			MΩ
vibration	20 G (20~5,000 Hz)				
shock	100 G for 10 ms				
compensated temperature	<100 kPa models all other models	0 -20		60 85	°C °C
operating temperature		-40		105	°C
storage temperature		-40		125	°C
life		1,000,000		cycles	
RoHS	yes				

#### **MECHANICAL**

.....

parameter	conditions/description	min	typ	max	units
measured medium	all 316L compatible liquids and gases				
housing/diaphragm	stainless steel 316L				
dimensions	s Ø19 x 14				mm
weight		19		25	g

#### **BASIC PARAMETERS**

parameter	conditions/description	min	typ	max	units
accuracy <sup>1</sup>			±0.5		%FS
hysteresis			±0.05	±0.1	%FS
repeatability			±0.05	±0.1	%FS
zero temperature drift <sup>1</sup>			±1.0	±1.5	%FS
span temperature drift <sup>1</sup>			±1.0	±1.5	%FS
thermal hysteresis			±0.05	±0.2	%FS
long term stability			±0.25		%FS/year
Note: 1. In the compensat	tion temperature range, refer to 25°C.				


#### **PRESSURE SPECIFICATIONS**

pressure range	pressure reference <sup>2</sup>	overload pressure	burst pressure
0~35 kPa	G	300%FS	400%FS
0~100 kPa	G, A	200%FS	300%FS
0~250 kPa	G	200%FS	300%FS
0~600 kPa	G	200%FS	300%FS
0~1.0 MPa	G	200%FS	300%FS
0~1.6 MPa	G, S	200%FS	300%FS
0~2.5 MPa	G, S	200%FS	300%FS
0~4.0 MPa	S	200%FS	300%FS
0~6.0 MPa	S	200%FS	300%FS

Note: 2. A=absolute pressure (vacuum is zero); G=gauge pressure (current atmospheric pressure as zero); S=sealed gauge pressure (calibrated atmospheric pressure is zero).

#### PART NUMBER KEY

.....



Base Number

- Pressure Reference:
- A = Absolute
- G = Gauge
- S = Sealed Gauge


Pressure Range: 350K = 35 kPa 100K = 100 kPa 250K = 250 kPa 600K = 600 kPa 100M = 1 MPa 160M = 1.6 MPa 250M = 2.5 MPa 400M = 4 MPa 600M = 6 MPa

#### **MECHANICAL DRAWING**

units: mm tolerance: ±0.1 mm unless otherwise noted


ITEM	DESCRIPTION	MATERIAL	PLATING/COLOR	
А	housing	SS 316L		
В	diaphragm	SS 316L		
С	oil filling	silicon oil		
D	o-ring	NBR	black	
E	wires	silicon; OD: 1.4 mm; 0.15 mm²		

WIRE CONNECTIONS				
Wire Color Function				
Red	VDD			
Blue	GND			
Yellow	OUT			

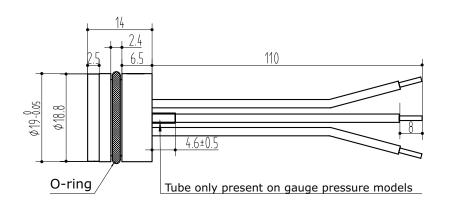

#### **INTERFACE DIAGRAM**

.....

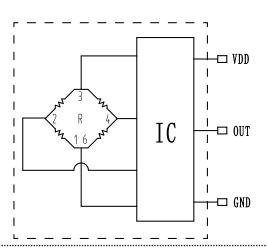

sameskydevices.com

#### **USAGE CONSIDERATIONS**

- 1. Do not touch the diaphragm with hard objects, which may cause damage to the diaphragm.
- 2. Strictly follow the wiring method, otherwise it may cause product damage or other potential faults.
- 3. Misuse of the product may cause danger or personal injury.
- 4. Pressure range can be selected higher or lower than actual conditions, but should be within ±30%FS.
- 5. Pressure reference consists of gauge pressure, absolute pressure, and sealed gauge pressure.

a. Gauge pressure is based on the current atmospheric pressure. Generally, it refers to the measurement of pressure which is greater than the current atmospheric pressure. Negative pressure is a special case of gauge pressure. It refers that there is such working condition that the pressure of work site is lower than the current atmospheric pressure.

b. Absolute pressure is based on vacuum.

c. Sealed gauge pressure uses absolute pressure die for gauge pressure product based on the atmospheric pressure of production site.

- 6. Confirm the maximum overload of the applied system, which should be less than the overload protection limit of the sensor, otherwise it will affect the product life or even damage the product.
- 7. The material and process for manufacturing negative pressure sensors are different from those of positive pressure sensors. So, gauge pressure sensors cannot be used as substitue of negative pressure sensors.

#### **REVISION HISTORY**

rev.	description	date
1.0	initial release	12/14/2021
1.01	logo, datasheet style update	08/05/2022
1.02	CUI Devices rebranded to Same Sky	09/12/2024

The revision history provided is for informational purposes only and is believed to be accurate.

Same Sky offers a one (1) year limited warranty. Complete warranty information is listed on our website.

# same sky

Same Sky reserves the right to make changes to the product at any time without notice. Information provided by Same Sky is believed to be accurate and reliable. However, no responsibility is assumed by Same Sky for its use, nor for any infringements of patents or other rights of third parties which may result from its use.

Same Sky products are not authorized or warranted for use as critical components in equipment that requires an extremely high level of reliability. A critical component is any component of a life support device or system whose failure to perform can be reasonably expected to cause the failure of the life support device or system, or to affect its safety or effectiveness.